Current part is item (0) on diagram. Available at www.oshkoshequipment.com

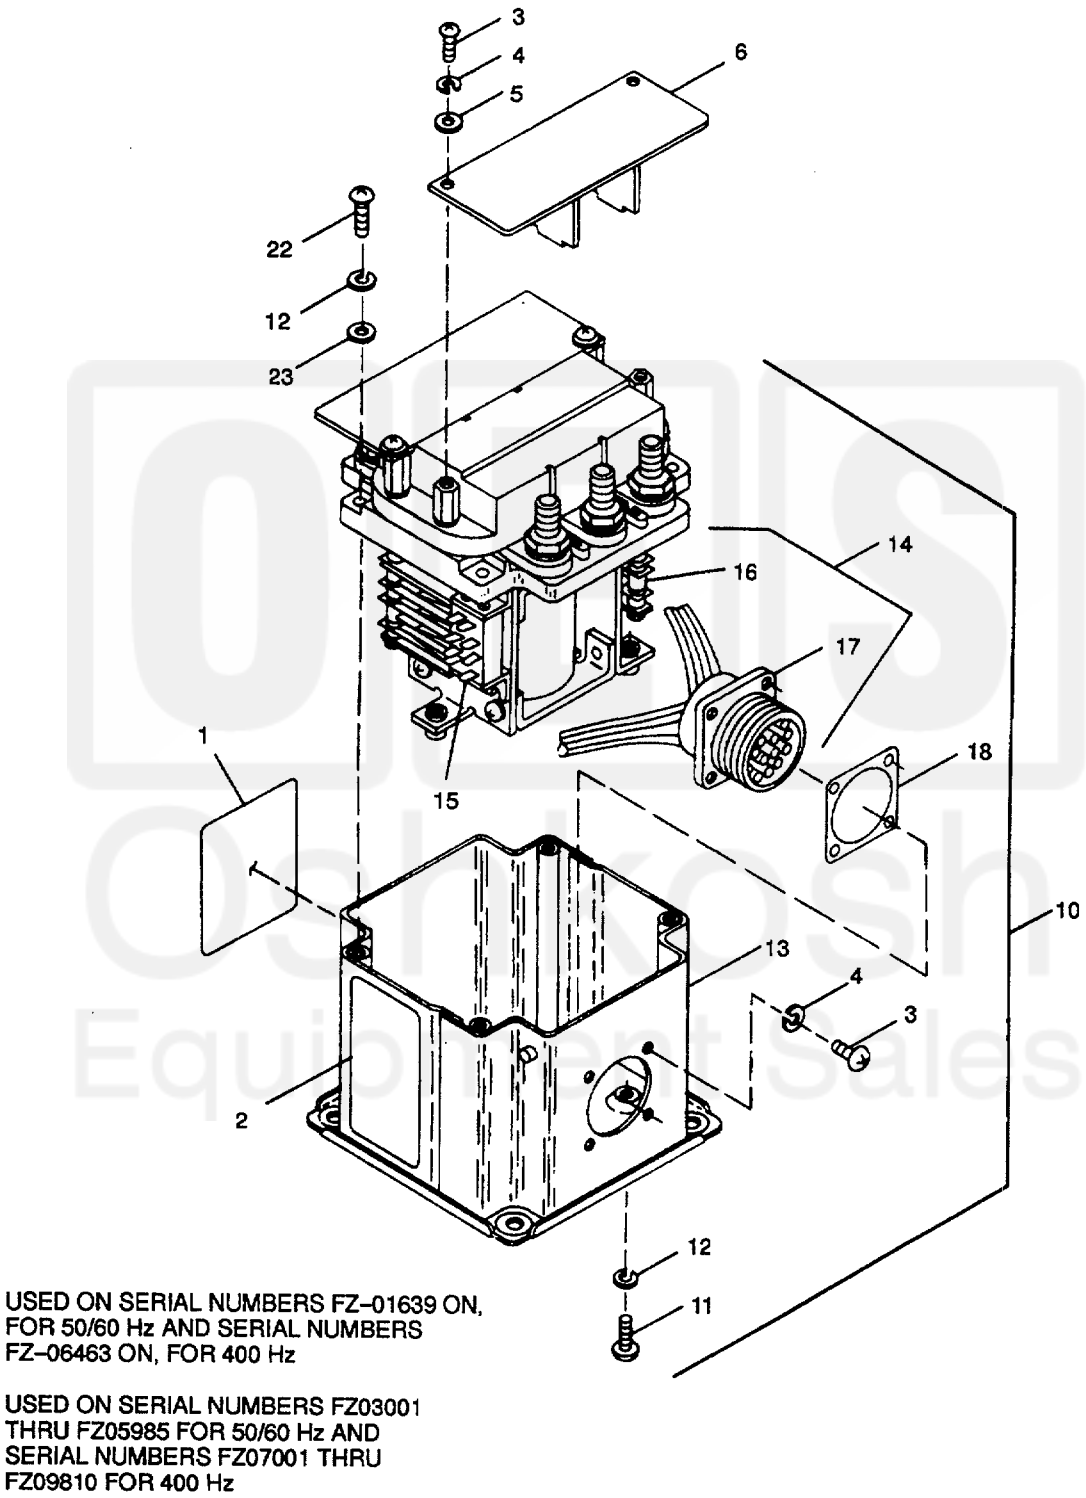

Figure 31. Main Load Conductor (Sheet 1 of 3)

(81 blank)/82

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

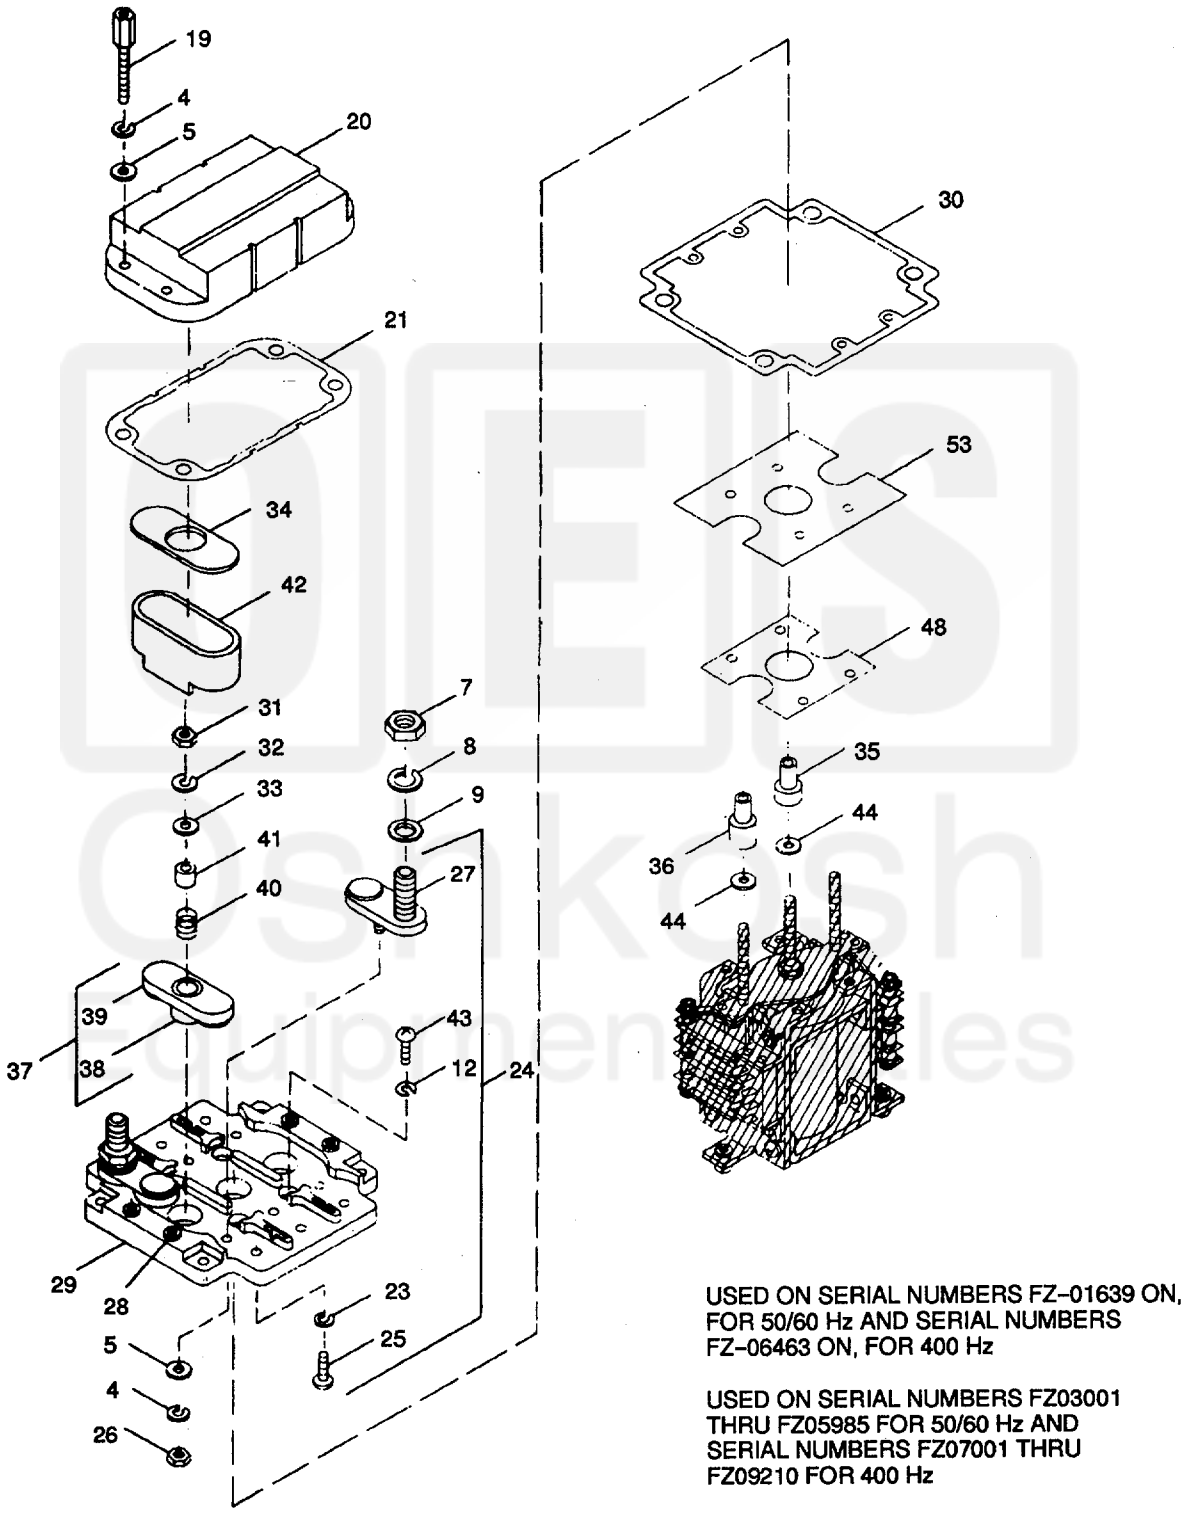

Figure 31. Main Load Conductor (Sheet 2 of 3)

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

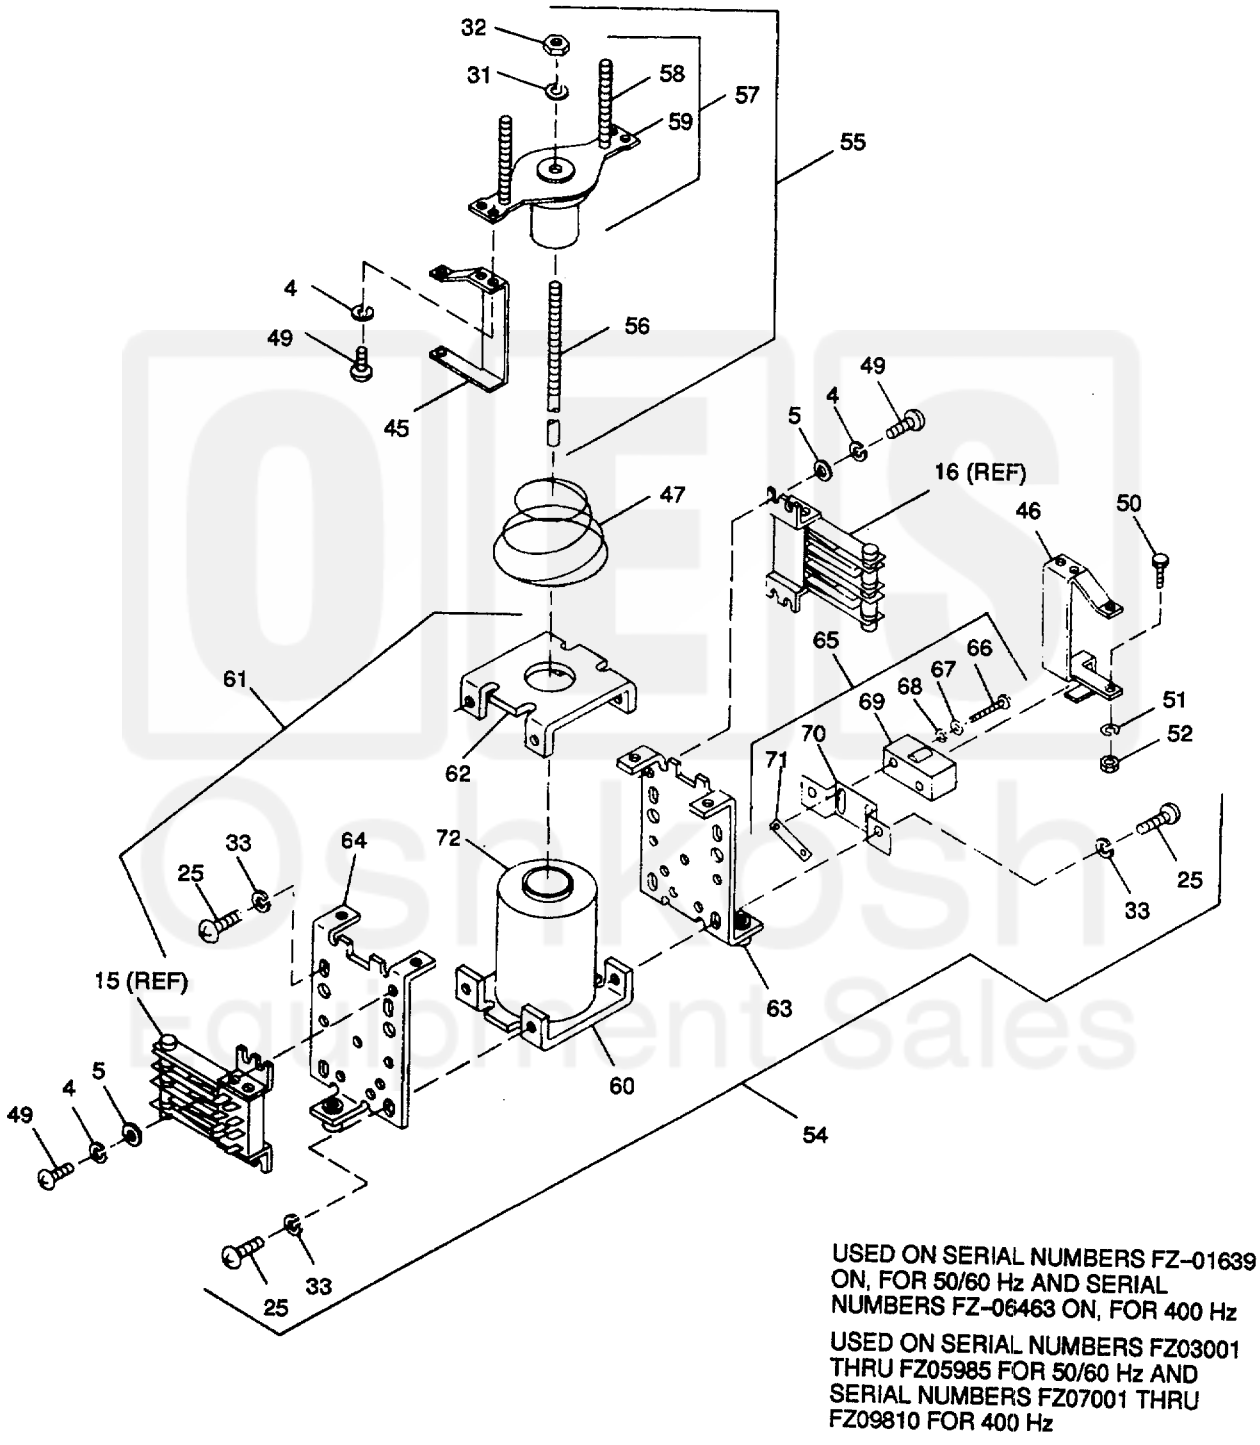

Figure 31. Main Load Conductor (Sheet 2 of 3)

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

(1) ILLUSTRATION		(2) SMR CODE				(3) USMC		(4)	(5) DESCRIPTION			(6)	(7)	(8)
(a) FIG NO.	(b) ITEM NO.	a ARMY	b AIR FORCE	c NAVY	d USMC	a SSI	b REPL FACTOR	NATIONAL STOCK NUMBER	REF NUMBER	MFR CODE	USABLE ON CODE	U/M	QTY INC IN UNIT	USMC QTY PER EQUIP
31		PAFFF	PAOOO	PAFFF	PAFHH	1	.040	5945-01-021-2898	LOAD CONTACTOR MAIN (USED ON S/N FZ-01639 ON, FOR 50/60 HZ & S/N FZ-06463 ON, FOR 400 HZ)			EA	1	1
									70-501-2	(30554)				
31	1	XCFZZ	MDO	XCFZZ	MDOZZ				PLATE			EA	1	1
									10818-1	(50603)				
31	2	XCFZZ	MDO	XCFZZ	MDOZZ				PLATE, WIRING			EA	1	1
									10380-1	(50603)				
31	3	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.008	5305-00-984-4988	SCREW, MACHINE 6-32 *X3/8*			EA	8	14
									MS35206-25	(96906)				
31	4	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.010	5310-00-045-4007	WASHER, LOCK NO 6			EA	4	45
									MS35338-41	(96906)				
31	5	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.010	5310-00-082-1404	WASHER, FLAT 3/8 X 156 X 049			EA	4	27
									MS27183-6	(96906)				
31	6	XBFZZ	XB	XBFZZ	XBHZZ				SHIELD, TERMINAL			EA	2	2
									10485-1	(50603)				
31	7	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.008	5310-01-008-6409	NUT, HEX 3/8-24 X 5/8 X 7/32			EA	6	6
									4971110017	(50603)				
31	8	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.010	5310-00-184-8971	WASHER, LOCK 11/16 X 3/8 X 0 094			EA	6	12
									MS35338-103	(96906)				
31	9	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.010	5310-00-080-6004	WASHER, FLAT 13/16 X3/8 X 0 062			EA	6	6
									MS27183-14	(96906)				
31	10	XAFZZ	XA	XAFZZ	XAHZZ				CONTACTOR ASSY SUB			EA	1	1
									10813-10	(50603)				
31	11	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.008	5305-00-889-3002	SCREW, MACHINE 8-32 X **5/**16			EA	3	11
									MS35206-242	(96906)				
31	12	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.010	5310-00-045-3299	WASHER, LCCK NO 8			EA	3	38
									MS35338-42	(96906)				
31	13	XBFZZ	XB	PAFZZ	XBHZZ				COVER			EA	1	1
									10741-10	(50603)				
31	14	PAFZZ	PAOZZ	PAFZZ	AHHZZ			5945-01-013-3842	SWITCH-CONN ASSY			EA	1	1
									10819-10	(50603)				
31	15	PAFZZ	PAOZZ	PAFZZ	PAHZZ	-	. 060	5945-01-016-0797	SWITCH, AUX			EA	1	1
									10788-10	(50603)				
31	16	PAFZZ	PAOZZ	PAFZZ	PAHZZ	-	. 060	5945-01-016-0798	SWITCH, AUX			EA	1	1
									11911-10	(50603)				
31	17	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.023	5945-01-013-3842	SWITCH-CONN ASSY			EA	1	1
									10819-10	(50603)				
31	18	PAFZZ	PAOZZ	PAFZZ	PAHZZ	I	.030	5330-01-008-6564	GASKET			EA	1	1
									3126760001	(50603)				
31	19	PAFZZ	PAOZZ	PAFZZ	XBHZZ			5365-01-008-6420	SPACER			EA	4	4
									10717-1	(50603)				
31	20	XBFZZ	XB	XBFZZ	XBHZZ				CHAMBER CONTACT			EA	1	1
									10484-1	(50603)				
31	21	PAFZZ	PAOZZ	PAHZZ	PAHZZ		.030	5330-01-014-6875	GASKET, HOUSING			EA	1	1
									10501-1	(50603)				
31	22	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.008	5305-00-984-6194	SCREW, MACHINE 8-32 X 5/8			EA	4	22
									MS35206-246	(96906)				
31	23	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.010	5310-00-809-8544	WASHER, FLAT 3/8 X 187 X 047			EA	14	28
									MS27183-7	(96906)				
31	24	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.005	5945-01-010-5912	BASE ASSY			EA	1	1
									10802-10	(50603)				
31	25	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.008	5305-01-008-6421	SCREW 10-32 X 1/2			EA	14	14
									4181100041	(50603)				
31	26	PAFZ	PAOZZ	PAHZZ	PAHZZ	D	.008	5310-01-008-6410	NUT, PLAIN, HEX			EA	6	6
									4911100011	(50603)				
31	27	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.001	6150-01-010-2597	BUS, CONDUCTOR			EA	6	6
									10497	(50603)				
31	28	XBFZZ	XB	XBFZZ	XBHZZ	I			INSERT			EA	4	4
									10064-1	(50603)				

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

(1) ILLUSTRATION		(2) SMR CODE				(3) USMC		(4)	(5) DESCRIPTION			(6)	(7)	(8)
(a) FIG NO.	(b) ITEM NO.	a ARMY	b AIR FORCE	c NAVY	d USMC	a SSI	b REPL FACTOR	NATIONAL STOCK NUMBER	REF NUMBER	MFR CODE	USABLE ON CODE	U/M	QTY INC IN UNIT	USMC QTY PER EQUIP
31	29	XAFZZ	XA	XBFZZ	XBHZZ				BASE, MAIN 10502-1	(50603)		EA	1	1
31	30	PAFZZ	PAOZZ	PAHZZ	PAHZZ	I	.030	5330-01-008-6565	GASKET 10505-1	(50603)		EA	1	1
31	31	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.008	5310-00-281-9389	NUT, PLAIN, HEX 10-32 X 3/8 X 1/8 X1898	(14351)		EA	3	3
31	32	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.010	5310-00-045-3296	WASHER, LOCK NO, 10 MS35338-43	(96906)		EA	4	13
31	33	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.010	5310-01-008-6596	WASHER, FLAT3/8X, 203X, 047 MS27183-7	(96908)		EA	9	9
31	34	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.005	5365-01-008-6422	SPACER 10812-1	(50603)		EA	3	3
31	35	XBFZZ	XB	XBFZZ	XBHZZ	D	.005		BUSHING 10692-1	(50603)		EA	1	1
31	36	XBFZZ	XB	XBFZZ	XBHZZ	D	.005		BUSHING, SLEEVE 10692-2	(50603)		EA	2	1
31	37	PAFZZ	PAOZZ	PAHZZ	PAHZZ	I	.007	5945-01-010-5913	BRIDGE ASSY 10715-10	(50603)		EA	3	3
31	38	XAFZZ	XA	XAFZZ	XAHZZ				HOUSING, SPRING 10483-1	(50603)		EA	3	3
31	39	XAFZZ	XA	XAFZZ	XAHZZ				BRIDGE, MAIN 10493-1	(50603)		EA	3	3
31	40	PAFZZ	PAOZZ	PAHZZ	PAHZZ	D	.015	5380-01-014-6934	SPRING 10703-1	(50803)		EA	3	3
31	41	XBFZZ	XB	XBFZZ	XBHZZ				BUSHING, SLEEVE 10048-1	(50803)		EA	3	3
31	42	XBFZZ	XB	XBFZZ	XBHZZ				ARC CHUTE 10481-1	(50803)		EA	3	3
31	43	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.008	5305-00-984-8193	SCREW, MACHINE 8-32 X 1/2 MS35208-245	(96908)		EA	4	4
31	44	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.010	5310-01-008-8424	WASHER, METALLIC 10209-1	(50803)		EA	1	1
31	45	PAFZZ	PAOZZ	PAFZZ	PAHZZ			5945-01-010-5914	AUX SWITCH 10422-1	(50603)		EA	1	1
31	46	PAFZZ	PAOZZ	PAFZZ	PAHZZ			5945-01-010-5915	AUX SWITCH 10422-2	(50603)		EA	1	1
31	47	PAFZZ	PAOZZ	PAFZZ	PAHZZ	I	.030	5360-01-008-6425	SPRING, RETURN 10122-1	(50603)		EA	1	1
31	48	XBFZZ	XB	XBFZZ	XBHZZ				DETENT 10078-2	(50603)		EA	1	1
31	49	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.008	5305-00-984-4982	SCREW, MACHINE 6-32 X3/16 MS35208-225	(96906)		EA	8	16
31	50	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.008	5305-01-008-6427	SCREW 4-40 X 3/8 4141100021	(50603)		EA	4	12
31	51	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.010	5310-00-543-2410	WASHER, LOCK, NO, 4 MS35338-40	(98908)		EA	4	16
31	52	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.008	5310-00-008-6411	NUT, PLAIN, HEX 1/4 X 3/32 4891110011	(50603)		EA	4	4
31	53	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.020	5970-01-010-5848	INSULATION 10718-1	(50603)		EA	1	1
31	54	PAFZZ	PAOZZ	PAFZZ	PAHZZ		.023	5945-01-010-5916	SOLENOID SUB ASSY 10798-10	(50603)		EA	1	1
31	55	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.008	5945-01-010-5920	MOVABLE CORE AND ROD ASSY 10795-10	(50603)		EA	1	1
31	56	XAFZZ	XA	XAFZZ	XBHZZ				ROD, CORE 10008-22	(50603)		EA	1	1
31	57	XAFZZ	XA	XAFZZ	XBHZZ				CORE ASSY, MOVABLE 10794-10	(50603)		EA	1	1
31	58	XBFZZ	XA	XAFZZ	XBHZZ				STUD, SELF LOCKING 4431100031	(50603)		EA	2	2

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

Current part is item (0) on diagram. Available at www.oshkoshequipment.com

(1) ILLUSTRATION		(2) SMR CODE				(3) USMC		(4)	(5) DESCRIPTION			(6)	(7)	(8)
(a) FIG NO.	(b) ITEM NO.	a ARMY	b AIR FORCE	c NAVY	d USMC	a SSI	b REPL FACTOR	NATIONAL STOCK NUMBER	REF NUMBER	MFR CODE	USABLE ON CODE	U/M	QTY INC IN UNIT	USMC QTY PER EQUIP
31	59	XAFZZ	XA	XAFZZ	XBHZ				OPERATOR 10421-1	(50603)		EA	1	1
31	60	XAFZZ	XA	XAFZZ	XBHZZ				FRAME AND CORE ASSY 10793-10	(50603)		EA	1	1
31	61	XAFZZ	XA	XAFZZ	XBHZZ				FRAME ASSY, SIDE 10790-10	(50603)		EA	1	1
31	82	XAFZZ	XA	XBFZZ	XBHZZ				FRAME-END 10007-2	(50603)		EA	1	1
31	63	XAFZZ	XA	XBFZZ	XBHZZ				FRAME AND SPACER 10792-10	(50603)		EA	1	1
31	64	XAFZZ	XA	XBFZZ	XBHZZ				FRAME AND SPACER 10791-10	(50603)		EA	1	1
31	65	PAFZZ	PAOZZ	PAFZZ	PAHZZ			5930-01-019-1280	SWITCH, SENSITIVE 10797-10	(50603)		EA	1	1
31	66	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.008	5305-00-959-1713	SCREW, MACHINE 2-56 X 3/4 MS35206-209	(96906)		EA	2	2
31	67	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.010	5310-00-543-5060	WASHER, LOCK NO, 2 MS35338-39	(96906)		EA	2	6
31	68	PAFZZ	PAOZZ	PAFZZ	PAHZZ	D	.010	5310-01-008-6597	WASHER FLAT , 250 X, 105 X , 032 5601100011	(50803)		EA	2	2
31	69	PAFZZ	PAOZZ	PAFZZ	PAHZZ	-	.060	5930-00-914-6450	SWITCH, SENSITIVE 11-314	(04426)		EA	1	1
31	70	XBFZZ	XB	XBFZZ	XBHZZ				BRACKET, SWITCH MOUNTING 10702-1	(50603)		EA	1	1
31	71	XBFZZ	XB	XBFZZ	XBHZZ				PLATE, ADAPTER 10701-1	(50603)		EA	1	1
31	72	PAFZZ	PAOZZ	PAFZZ	PAHZZ	-	.008	5950-01-018-0230	COIL, RADIO FREQUENCY 10353-940	(50603)		EA	1	1

Current part is item (0) on diagram. Available at www.oshkoshequipment.com