

(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)	(9)	(10)
SMR	Federal	DESCRIPTION	UNIT	Qty	30-day DS maint	30-day GS maint	1-yr	Depot	Illustration
Code	Stock		of	inc.	allowance	allowance	alw	maint	
Number			meas	in			per	alw	
			Unit				100	per	(a)
							equip	100	Figure
							cnt-	equip	No.
					(a)	(b)	(c)	(a)	(b)
					1-20	21-50	51-100	1-20	21-50
								51-100	gcy

Reference Number & Mfr. Code


Usable On Code

GROUP 08-TRANSFER AND FINAL  
DRIVE ASSEMBLIES

0801-POWER TRANSFER AND FINAL  
DRIVE ASSEMBLIES

NOTE.  
SEE GROUP 3301 FOR LISTING OF TRANSFER CONTAINER PARTS

P-F-S	2520-089-377	TRANSFER ASSEMBLY WITH CONTAINER: SHIPPING AND STORAGE 5702826 (19207)	A	EA	1	*	*	*	*	*	*	10	20	50	1
P-F-S	2520-086-337	TRANSFER ASSEMBLY WITH FLANGES: 7748580 (19207)	A	EA	1	*	*	*	*	*	*			50	2
P-F	2520-040-225	SUPPORT: TRANSFER ASSEMBLY 7376177 (19207)	A	EA	1	*	*	*	*	*	*	4	10	51	1
P-F	5305-940-951	SCREW,CAP,HEXAGON: SUPPORT MS51106-421 (96906)	A	EA	3	*	*	*	*	*	*	6	10	51	2
P-F	5310-531-912	WASHER,FLAT: SUPPORT 7418962 (19207)	A	EA	3	*	*	*	*	*	*	6	10	51	3
P-F	5340-741-106	MOUNT,RESILIENT: SUPPORT 7411068 (19207)	A	EA	6	*	*	*	*	*	*	4	10	51	4
P-F	2520-737-624	SUPPORT,TRANSFER CASE: 7376240 (19207)	B,BF,CA,CB DA,DB,FA,FB, HA,BE,IA,BD	EA	3	*	*	*	*	*	*	4	10	51	5
P-F	5310-275-204	NUT,SELF-LOCKING,HEXAGON: TRANSFER SUPPORT MS20365-8200 (96906)	A	EA	6	*	*	*	*	*	*	6	10	51	6
P-F	5320-018-951	RIVET,SOLID: TRANSFER SUPPORT 189510 (21450)	A	EA	9	*	*	*	*	*	*	6	10	51	7
P-F	5305-044-550	SCREW,CAP,HEXAGON: SUPPORT MS90725-160 (96906)	A	EA	7	*	*	*	*	*	*			51	8
P-F	5310-012-157	WASHER,LOCK: SUPPORT MS35338-31 (96906)	A	EA	7	*	*	*	*	*	*	6	10	51	9
P-F	2520-040-225	SUPPORT: 7376178 (19207)	A	EA	1	*	*	*	*	*	*	4	10	51	10
X1		GASKET: INPUT SHAFT REAR BEARING COVER (COMPONENT OF GASKET SET FSN 2520-734-6775 7375291 (78500)	A		1									52	1
P-F	5310-584-527	WASHER,LOCK: REAR BEARING MS35338-48 (96906)	A	EA	4	*	*	*	*	*	*	6	10	52	2

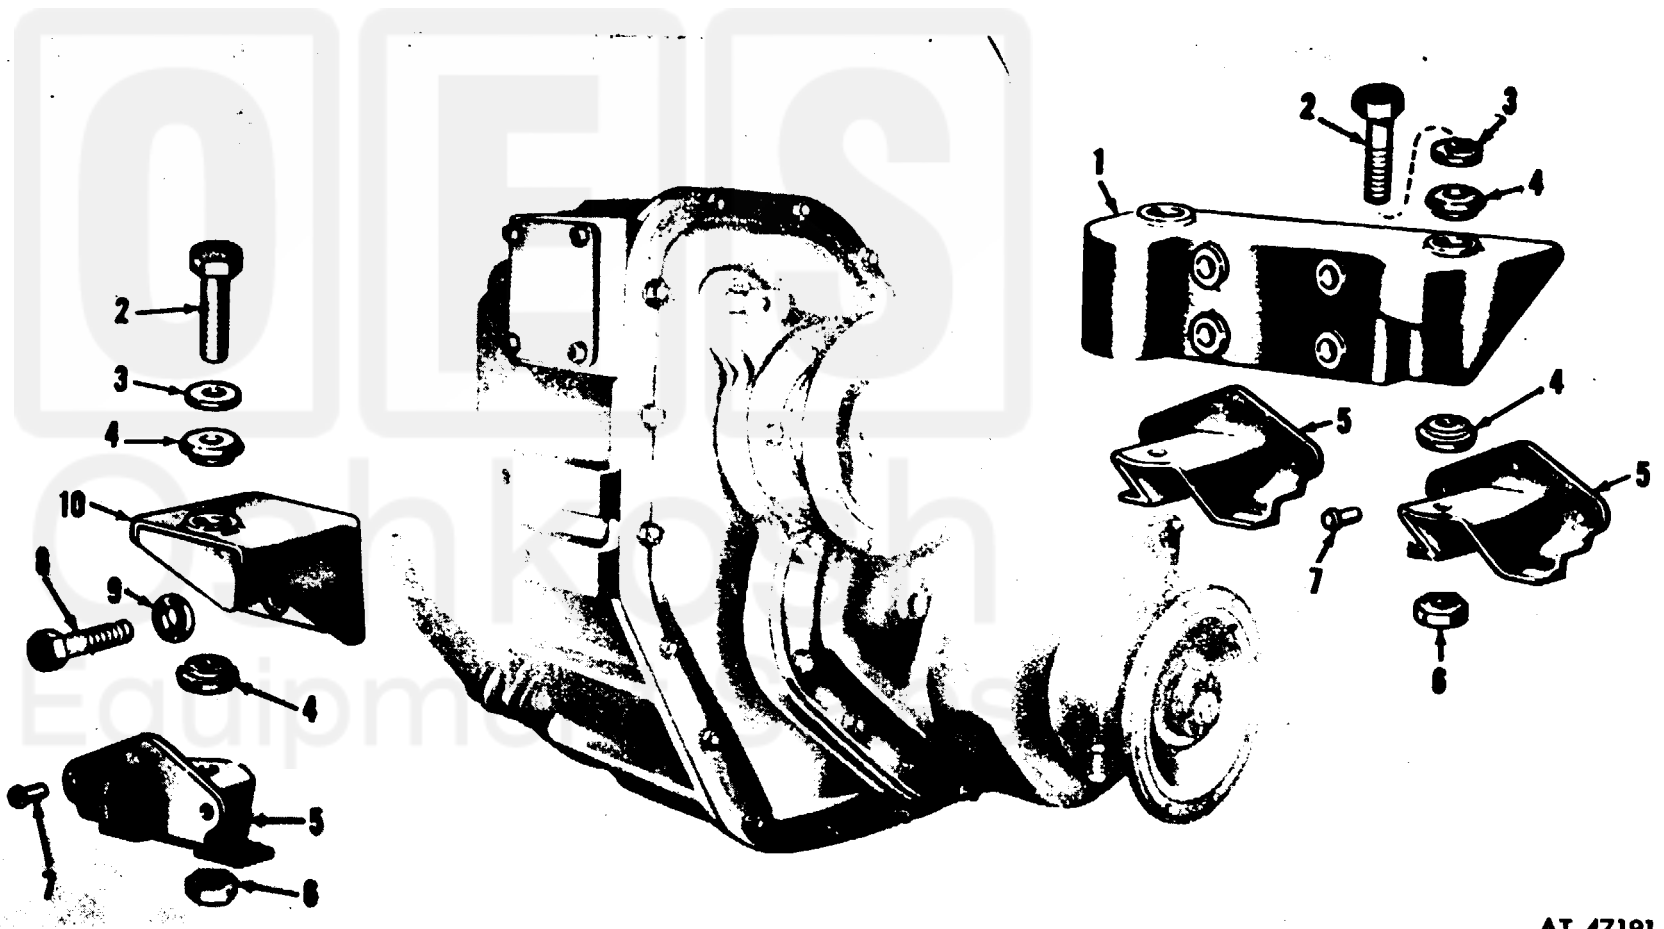

AT 47191

Figure 51. Transfer assembly mounting parts.