

Current part is item (7) on diagram. Available at www.oshkoshequipment.com

TM9-2320-211-34P

(1) SMR Code	(2) Federal Stock Number	(3) DESCRIPTION	(4) UNIT of meas	(5) Qty inc. in Unit	(6) 30-day DS maint allowance			(7) 30-day GS maint allowance			(8) 1-yr alw per 100 equip cnt- gcy	(9) Depot maint alw per 100 equip	(10) Illustration	
					(a) 1-20	(b) 21-50	(c) 51-100	(a) 1-20	(b) 21-50	(c) 51-100			(a) Figure No.	(b) Item No.
		Reference Numl Usable On Code												
P-F-R	2520-740-9588	2004-POWER TAKE-OFF ASSEMBLY POWER TAKEOFF,AD TALL MODELS WITH WINCH EXCEPT M51 7409588 (19207)	EA	1	*	*	*	*	*	*	10	20	274	1
P-F-R	2520-740-9589	POWER TAKE-OFF AK 7409589 (19207)	EA	1	*	*	*	*	*	*	10	20	274	1
P-F	2520-447-3406	GASKET: MOUNT,AD 8327322 (19207)	EA	1	*	*	*	*	*	*	10	20	274	2
P-F	2520-706-1160	CASE WITH NAM,AD 7061160 (19207)	EA	1	*	*	*	*	*	*	2	5	274	3
P-F	2520-706-1270	GASKET: CASE ,AD (COMPONENT OF KIT, REPAIR POWER TAKE-OFF, FSN 2520-692-6187) 7061270 (19207)	EA	1	*	*	*	*	*	*	10		274	4
X1		HOUSING: (USE) AK TRANSMISSION, FSN 2520-740-9589) 7061194 (19207)		1									274	5
P-F	2520-706-1269	CAP OUTPUT: CI,AD BEARING (USED ON POWER-TAKE-OFF, TRANSMISSION, FSN 2520-740-9588) 7061269 (19207)	EA	1	*	*	*	*	*	*	3	5	274	6
P-F	5330-559-8733	SEAL: CAP (CON,AD POWER-TAKE-OF, FSN 2520-692-6187) 7376546 (19207)	EA	1	*	*	*	*	*	*	10		274	7
P-F	5305-225-8499	SCREW,CAP,HEX,AD MS90725-34 (96906)	EA	9	*	*	*	*	*	*	8	20	274	8
P-F	5310-407-9566	WASHER,LOCK: I,AD MS35338-45 (96906)	EA	9	*	*	*	*	*	*	8	20	274	9
P-F	2520-447-3406	GASKET: COVER,AD OF KIT, REPAIR POWER-TAKE-OFF, FSN 2520-692-6187) 5214787 (19207)	EA	1	*	*	*	*	*	10		274	10	
P-F	2520-354-0771	COVER,ACCESS: AD 5323473 (19207)	EA	1	*	*	*	*	*	*	3	5	274	11
P-F	5310-637-9541	WASHER,LOCK: (AK MS35338-46 (96906)	EA	7	*	*	*	*	*	*	6	20	274	12
P-F	5305-269-3208	SCREW,CAP,HEX,AD COVER, ACCESS MS90725-57 (96906)	EA	6	*	*	*	*	*	*	6	20	274	13

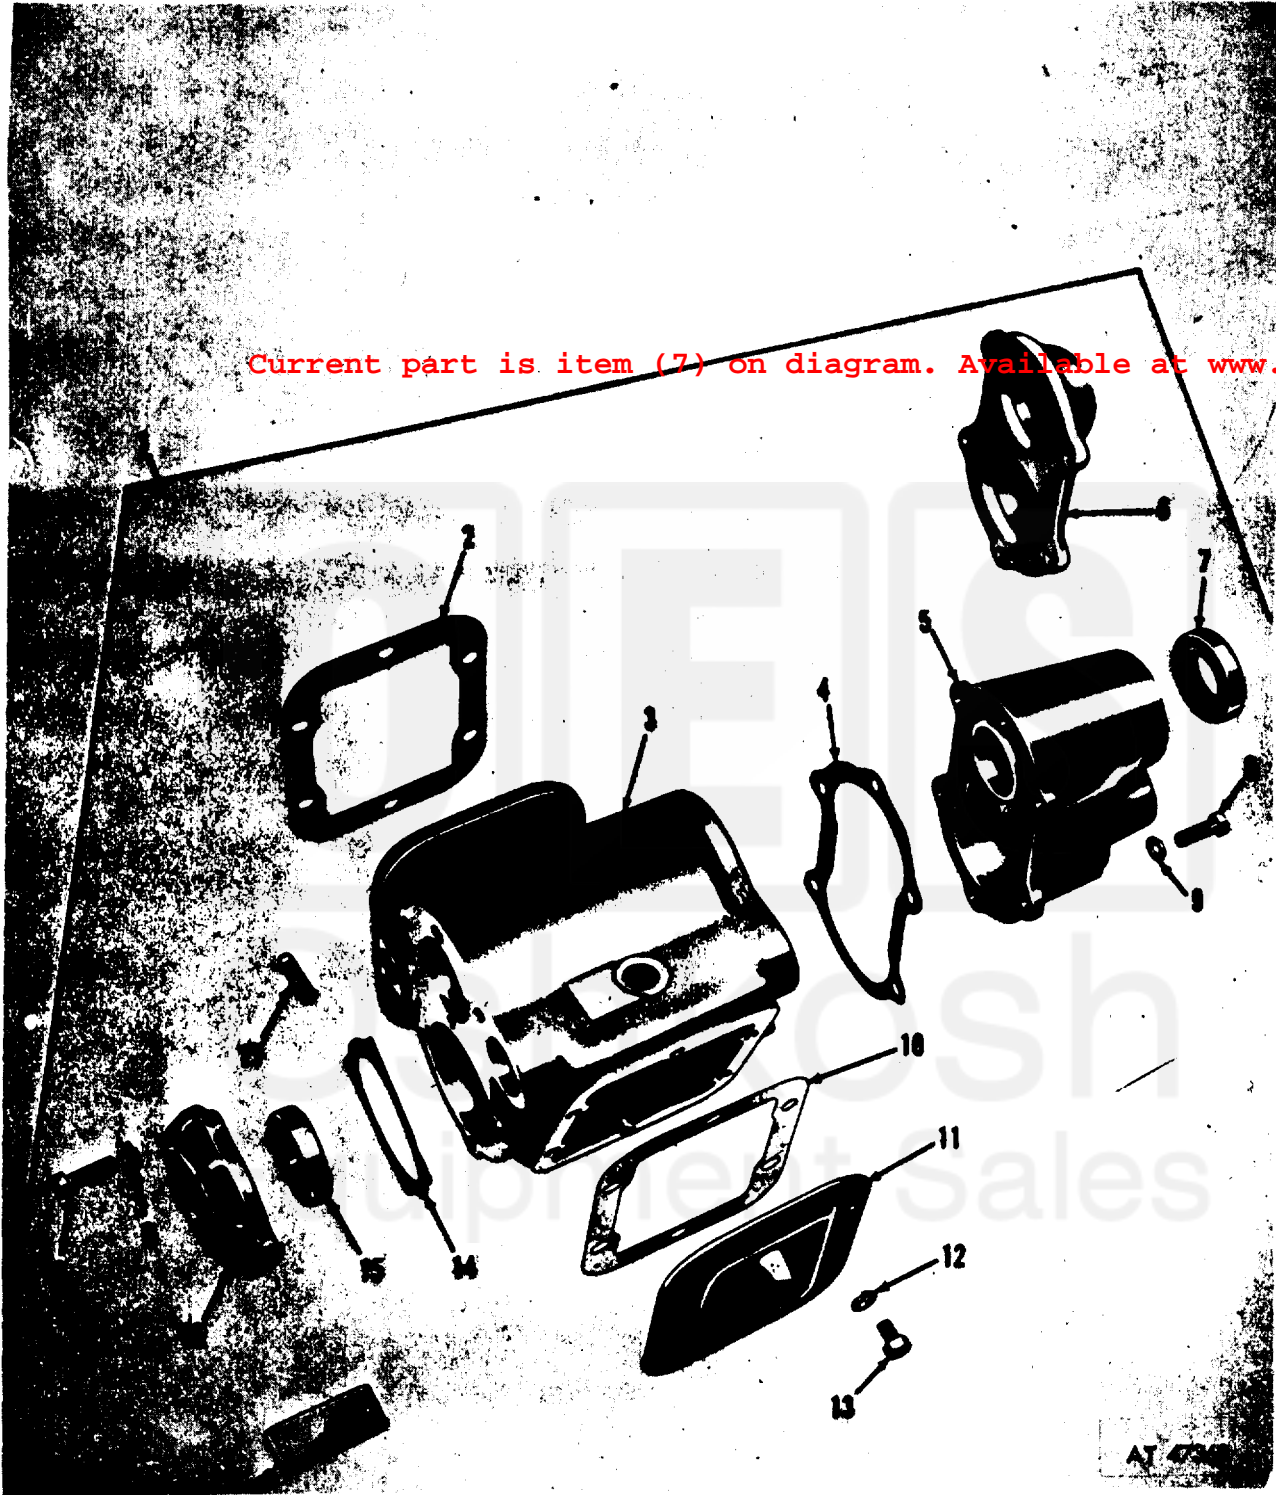


Figure 274. Transmission power takeoff assembly (1 of 3).